



Your Cyber Jeep® Shop

MENU

PILAND MAIN
PAGE

Piland Electronics

Replacement Jeep Remotes
Keyless Entry Transmitters

JeepRemotes.Com

The 5 Digit Code for Single Button Jeep Remotes

GETTING THE JEEP REMOTE CODE ON SINGLE BUTTON REMOTES

The five digit code for the Jeep single button remote transmitter is required to code the transmitter to match the receiver in a vehicle. The five digit code will **always** be printed on a piece of paper and never contains a **9** in the first five digits. If the customer has the original jeep remote transmitter, the code is located inside the clamshell case. The case can be opened by inserting a dime in the ring corner and then pry open similar to opening an oyster. Once the case is opened, the printed circuit board has to be removed completely in order to read the code. Typically customers will read the number 16019 D etched on the printed circuit board as the code. This code is not valid for two reasons: first it contains a 9 in the first five digits and second it is not written on a slip of paper. When obtaining a code, leading 0's are important since they are part of the code. For example, some codes are followed by a sixth digit that is typically a different type set. In this case a code of 05534 6 is 05534 not 55346! In the event that the customer has lost their transmitter, the code may have been written in their owners manual.

1988-1989 Models


If the code has not been recorded in the owners manual it can be retrieved from the receiver. **The code in receivers is also written on a piece of paper.** On year models **1988 and 1989** the receiver has a rectangular cover and is located **over** the rear view mirror. The Jeep receiver can be removed by gripping the left and right sides of the lens and pulling the lens out. Once the lens is removed the receiver can be pulled out. The code is typically written on a white sticker on the case of the receiver. After the code is obtained, insert the receiver back into its original position then replace the lens.

1990-Mid 1992

Receivers in Jeep 1990 vehicles through mid-year 1992 are typically in overhead consoles. To obtain codes from these Jeep receivers, a Phillips screw is removed from

the console above the rear view mirror. The console is lowered then two Phillips screws are removed from the receiver. After the two screws are removed from the receiver, the code can be obtained from the white paper sticker. One typical bad code obtained from overhead consoles is 52019 B, this number is printed on the circuit board by the wire harness. If this number has been reported instruct the customer to remove the receiver from the console to read the other side where the code is located. (Note that this number, 52019 contains a 9 within the 5 digits automatically indicating a bad code.)


Step 1

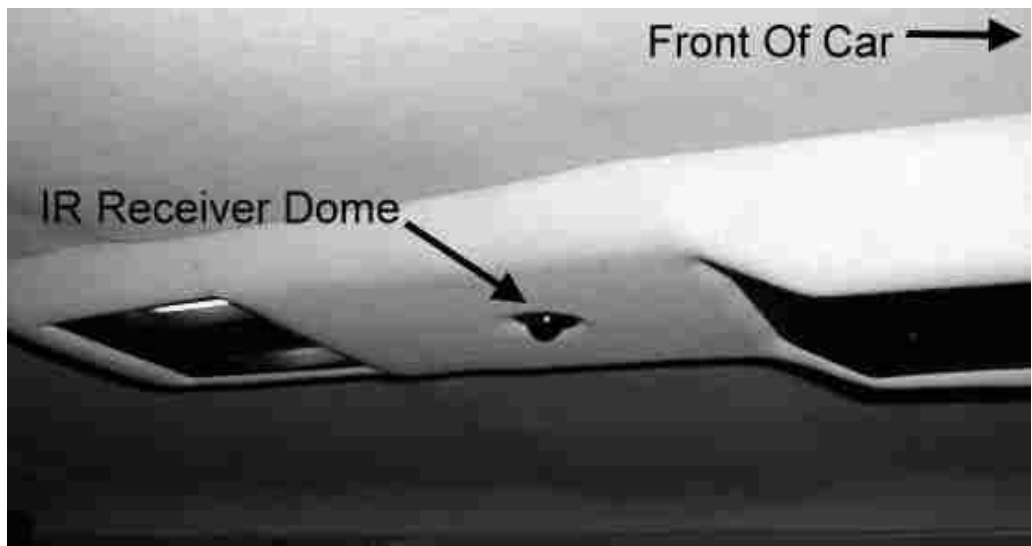

Step 2



Step 3

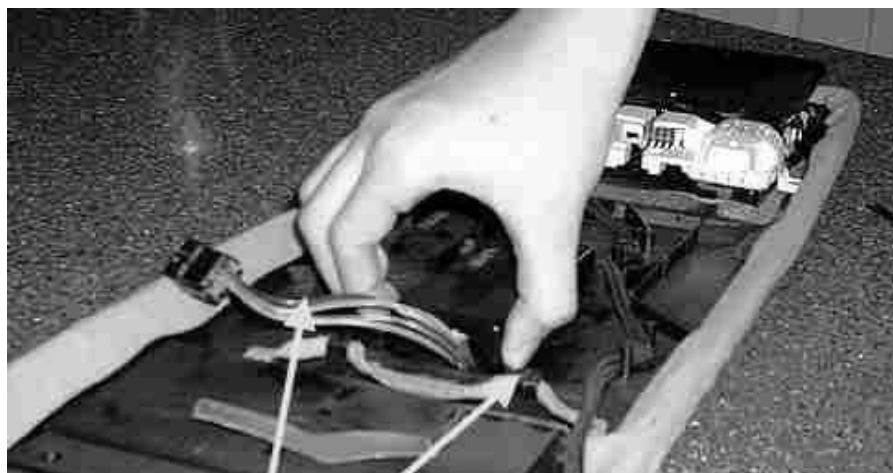



Step 4



Step 5



There are three known incorrect codes that occur frequently. These codes do not contain 9's in the first five digits so always check a reported code against the following codes. The single most common bad code is **44137**. The other two bad codes are **15848** from the newer style receiver board and **15128** from the old style receiver board. Since these do not contain a 9 they can represent a valid code but they have never produced a good code.

[Return to Top](#)

[Return To Main Page](#)

©2002 No Part Of This Online Catalog Can Be Reproduced With Out Written Permission.
Jeep® Is A Registered Trademark Of The DiamlerChrysler Corp. Turner 4WD Parts Company Is Not Affiliated With The
DiamlerChrylser Corporation. No Implication Is Made That These Are Original Equipment Parts.